### Blackpool Council Licensing Service

# Representation made by a Responsible Authority In support of an application for the Review of an existing Premises Licence or Club Premises Certificate

Responsible Auth	ority making	represen	itation				
Name of Responsible Authority		Health and Safety Enforcement					
Name of Officer	Gareth Shaw						
Contact telephone number		478315					
Date representation made		11	05	14			
Do you consider mediation approp		oriate			YES	NO	
Name of Respons	ible Authority	/ Applic	ant who	requeste	d a revie	w of this	s Licence
Licensing Authority	′						
Premises Details							
Premises Name	Underbar						
Address	Bank Hey Street						
	Blackpool						
Post Code	FY1 4RU						
Details of your re (Please reference					plicatio	1	
This Authority would	ld like to bring t	to the atte	ention of t	the comm	nittee the	following	;
The Health and Sa 2010 and this supp					rt for a re	view by \	Weights and Measures in
raised mainly	The Premises				,	•	umber of issues were

with the lack of cleanliness, lack of Organisation, electrical problems and the excessive storage of combustible

materials.


The concerns were followed up in writing and Health and Safety have been consulted and will be

photographic evidence is included below;





1) Ice machine required cleaning and cluttered cleaning storage in public area

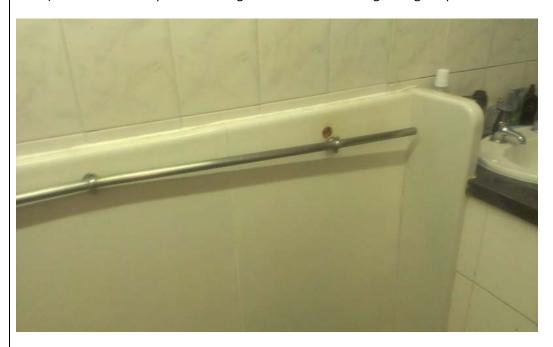


2) Damaged water pipework in toilet area.



3) Poorly maintained toilet facilities-waste on floor.



4) Poorly maintained toilet facilities-unrepaired damage.

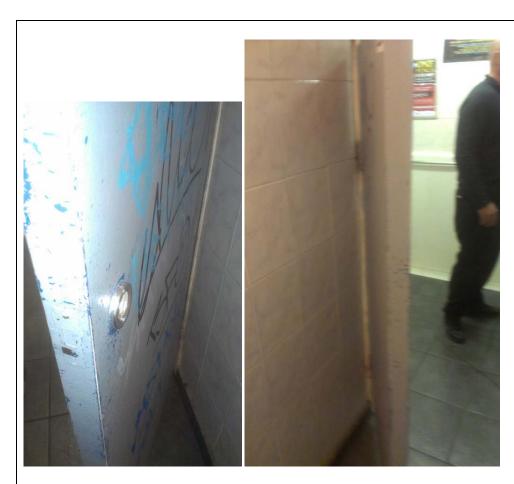

5) Poorly maintained toilet facilities- no locks or handles on doors.






6) Poorly maintained toilet facilities-unrepaired damage and dirty ventilation.




7) Damaged electrical funiture compramising IPX ratings.




8) Unclear PAT testing system

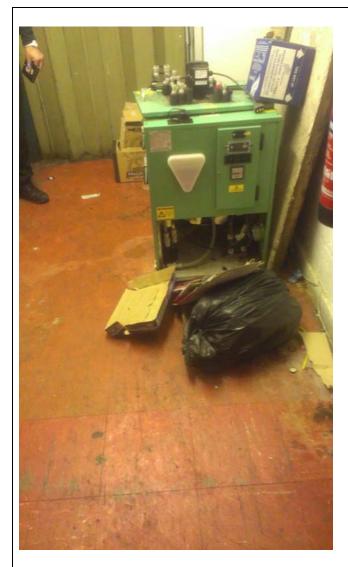

9) Redundant equipment and waste acuumulating.

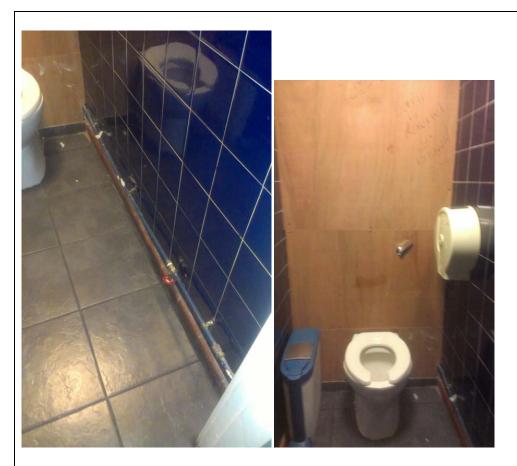

10) Water pipes loosesfrom fixings and untreated wooden surface in tolet areas

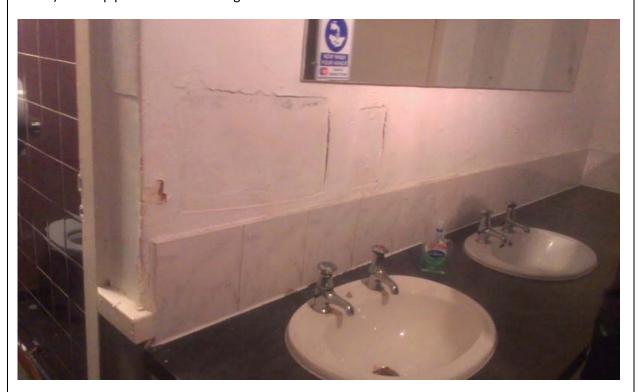

11) Poorly maintained wash facilities.



12) Broken mirror covered with untreated wood in toilet area.




RA Representation Form: Page 8 of 25

## 13) Cluttere storage in cellar area.







14) Uncovered water storage tanks.

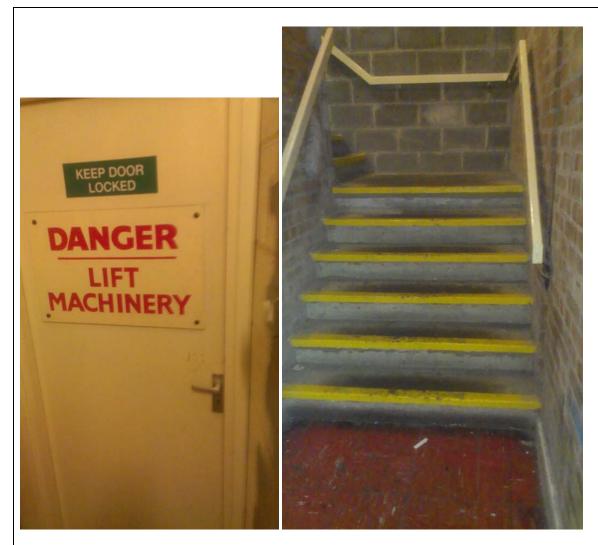

15) Lift machinery door left unlocked and poor cleanliness of steps.

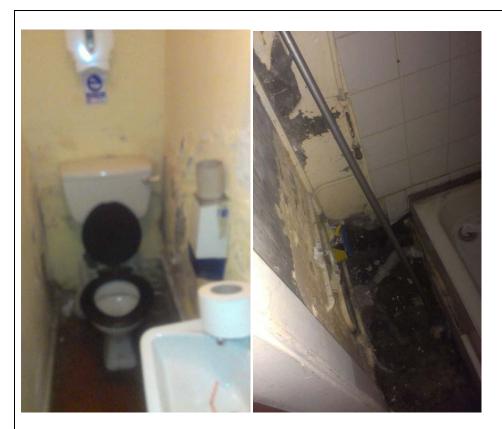


16) Very poorly maintained toilet facilities.

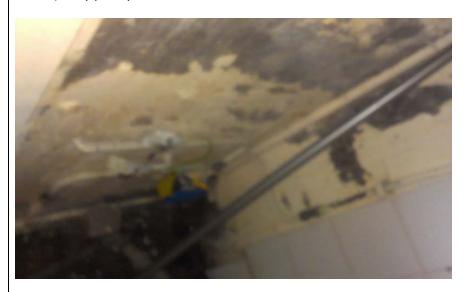

17) Very poorly maintained toilet facilities.



18) Gas pipe requiring further investigation/inclusion in certification.

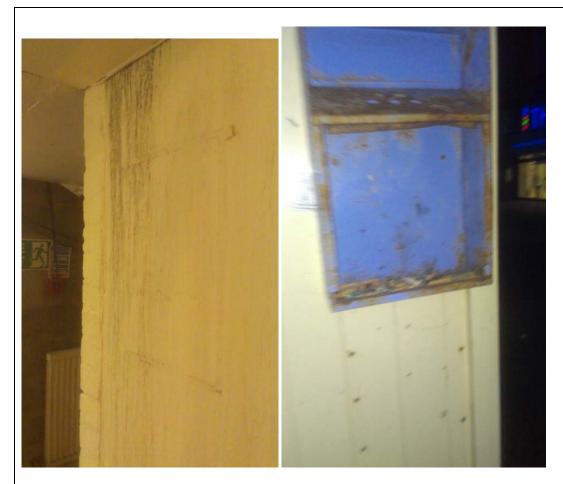

19) Poor cleanliness of walls and poorly maintaied ashtrayat the entrance.

#### 21st of March 2014

Date: 27th March 2014

Underbar Blackpool Ltd Bank Hey Street Blackpool FY1 4RU Our Ref: JH/CW Direct Line: (01253) 478349 Email: jacqui.harrison@blackpool.gov.uk

Dear Sir or Madam

Re: Health and Safety at Work etc Act 1974 Underbar, Bank Hey Street

Further to my visit on 21st March 2014 please find enclosed a leaflet on RIDDOR. At the time of inspection Ben McCarthy was not confident in the requirements of the legislations and looking through the historic accident reports there are some which may have been reportable at the time.

The health and safety law poster on display is the 1999 version. This has now been replaced by the 2009 version. The five year transition to the new version ends on 5<sup>th</sup> April 2014. Please update the poster on display accordingly.

It was noted there are several health and safety management systems in use at the time of inspection. A recommendation would be to use just one system making it easier to follow and update when required.

Yours faithfully

Jacqui Harrison Public Protection Officer (Health and Safety Enforcement)

Public Protection Division Health and Safety Enforcement Progress House Clifton Road Blackpool FY4 4US Contact T: (01253) 478315 www.blackpool.gov.uk

## 3<sup>rd</sup> of May 2014




1) Poor cleanliness of walls



2) Cracked socket.




3) Poor cleanliness of cooler vetilation.

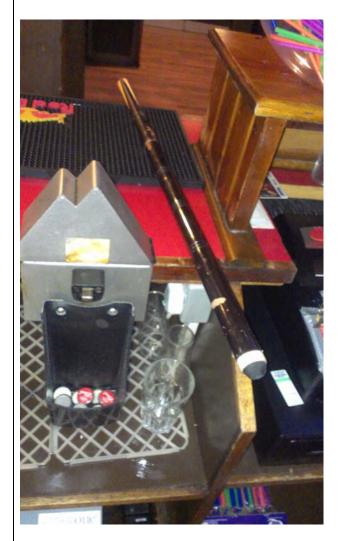

4) Sawn cue next stored behind the bar.



5) Drug associated bag in toilet.

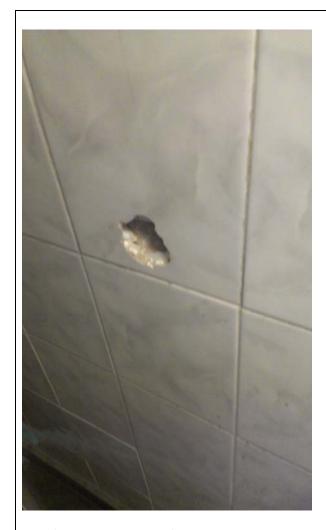

6) Damaged tiles left unrepaired.



7) Locks missing from toilet doors.



8) Unrepaired damge.




9) Build up of dirt on ventilations.




10) Fire seperation door wedged open




11) Temporay repair with tape not IPX rated.

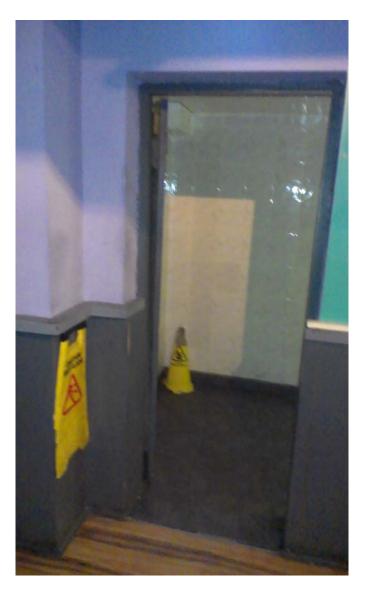

12) Wet floor signs in permanent use.

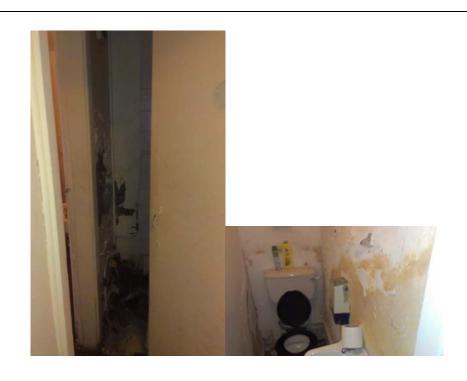

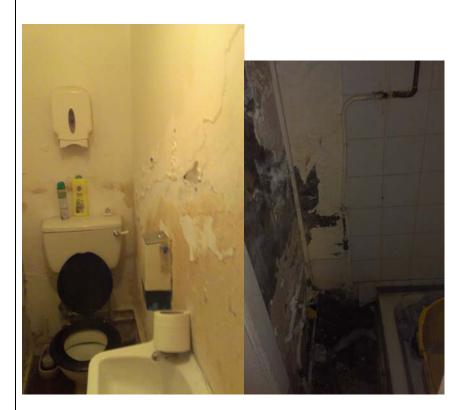

13) Poorly maintained toilet facilities.



14) Lift equipment that is not tested or inspected used for storing stock.

In addition to this Mr Lawrence appeared during this inspection and became very aggitated demanding that we all wait outside of the premise and I noted that a toilet atendant present at the time left the premises in a hurry.